



CALL 1-800-999-3600

WALL OPENING DETAIL

DIMENSIONS IN MILLIMETRES
(DIMENSIONS IN INCHES)

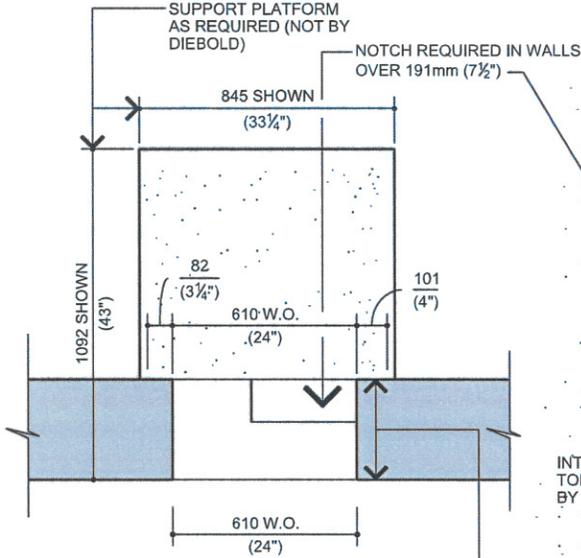


PLAN VIEW

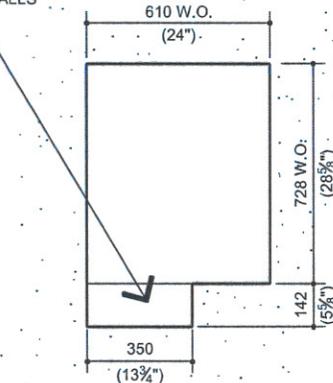

INTERIOR FLOOR LEVEL OR TOP OF SUPPORT PLATFORM BY THE OWNER'S G.C.

INTERIOR ELEVATION

DETAIL FOR WALLS OVER 191mm (7½")

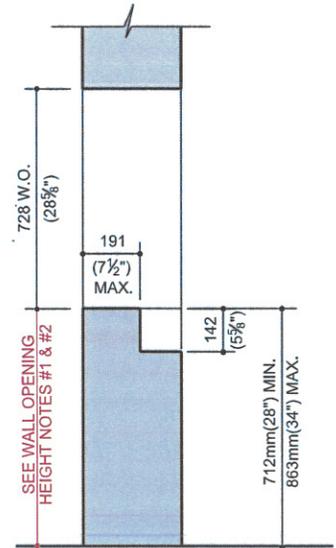

SEE WALL OPENING HEIGHT NOTES #1 & #2

MAX. WALL IN AREA OF UNIT

SECTION

330mm (13") MAX. WALL THICKNESS IN AREA OF UNIT

WALL OPENING HEIGHT NOTE #1:


CSA 766mm (30½") MAXIMUM HEIGHT FROM EXTERIOR SIDEWALK / FLOOR LEVEL TO BOTTOM OF WALL OPENING FOR CANADIAN STANDARDS ASSOCIATION (CSA) REQUIREMENTS. INSIDE FLOOR LEVEL CANNOT EXCEED 54mm (2½") ABOVE EXTERIOR SIDEWALK / FLOOR LEVEL AND STILL COMPLY WITH THESE STANDARDS

ADA 788mm (31") MAXIMUM HEIGHT FROM EXTERIOR SIDEWALK / FLOOR LEVEL TO BOTTOM OF WALL OPENING FOR AMERICANS WITH DISABILITIES ACT (ADA) REQUIREMENTS. INSIDE FLOOR LEVEL CANNOT EXCEED 76mm (3") ABOVE EXTERIOR SIDEWALK / FLOOR LEVEL AND STILL COMPLY WITH THESE STANDARDS

CAE 817mm (32½") MAXIMUM HEIGHT FROM EXTERIOR SIDEWALK / FLOOR LEVEL TO BOTTOM OF WALL OPENING FOR CENTRE FOR ENVIRONMENTS (CAE) REQUIREMENTS. INSIDE FLOOR LEVEL CANNOT EXCEED 105mm (4½") ABOVE EXTERIOR SIDEWALK / FLOOR LEVEL AND STILL COMPLY WITH THESE STANDARDS


FOR ALL THREE STANDARDS ABOVE, WHERE INSIDE FLOOR IS MORE THAN 863mm (34") BELOW THE BOTTOM OF THE WALL OPENING THE OWNER'S G.C. MUST PROVIDE A SUPPORT PLATFORM.

* PROVIDE VERTICAL AND HORIZONTAL FLAT PLUMB SURFACE AROUND WALL OPENING FOR PROPER INSTALLATION OF THE ATM

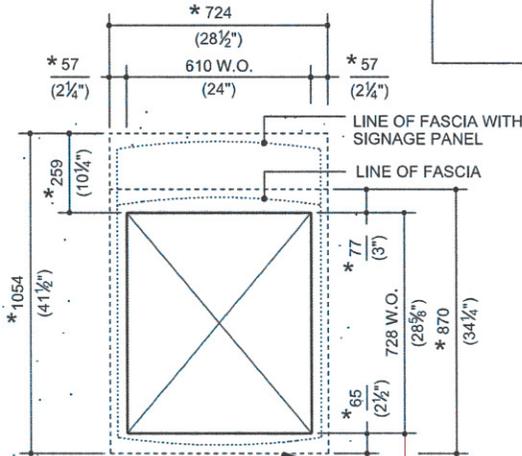

* CLEARANCE REQUIRED AROUND WALL OPENING FOR PROPER INSTALLATION OF ATM

SEE WALL OPENING HEIGHT NOTES #1 & #2

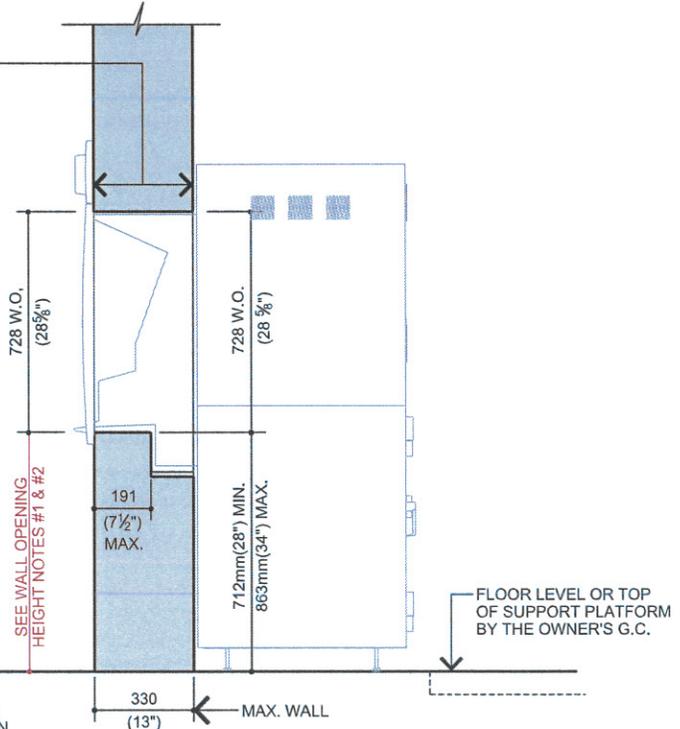

SEE WALL OPENING HEIGHT NOTES #1 & #2

FLOOR LEVEL OR TOP OF SUPPORT PLATFORM BY THE OWNER'S G.C.

VERTICAL SECTION

WALL OPENING HEIGHT NOTE #2

VERIFY INSIDE FLOOR AND EXTERIOR SIDEWALK / FLOOR LEVEL HEIGHTS PRIOR TO CONSTRUCTING WALL OPENING. IF INSIDE FLOOR LEVEL IS HIGHER OR LOWER THAN EXTERIOR SIDEWALK / FLOOR, DIMENSION FOR WALL OPENING HEIGHT MUST BE ADJUSTED ACCORDINGLY AND OPTIMUM OPERATING HEIGHTS MAY NOT BE MET.


EXTERIOR ELEVATION

ANCHOR BOLT

RECOMMENDED ANCHOR BOLT SIZE - M20 19mm (3/4") (NOT SUPPLIED WITH ATM).


CABLE ENTRY

ELECTRICAL AND DATA CABLING ENTERS THE ATM THROUGH A CABLE ENTRY OPENING ON THE SIDE OF THE SAFE. CABLES ENTERING THE ATM PASS THROUGH THE POWER CABLE PLATE WHICH IS ATTACHED TO THE INSIDE WALL OF THE SAFE OVER THE CABLE ENTRY OPENING. CABLING CAN ENTER FROM THE SIDE OR OPTIONALLY FROM UNDER THE ATM. THE CABLE ENTRY OPENING IS ON THE RIGHT SIDE OF THE SAFE AS VIEWED FROM THE REAR OF THE ATM.

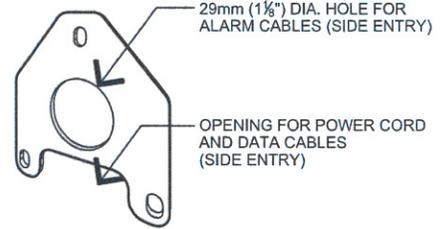

POWER CABLE PLATE

DIMENSIONS IN MILLIMETRES
(DIMENSIONS IN INCHES)

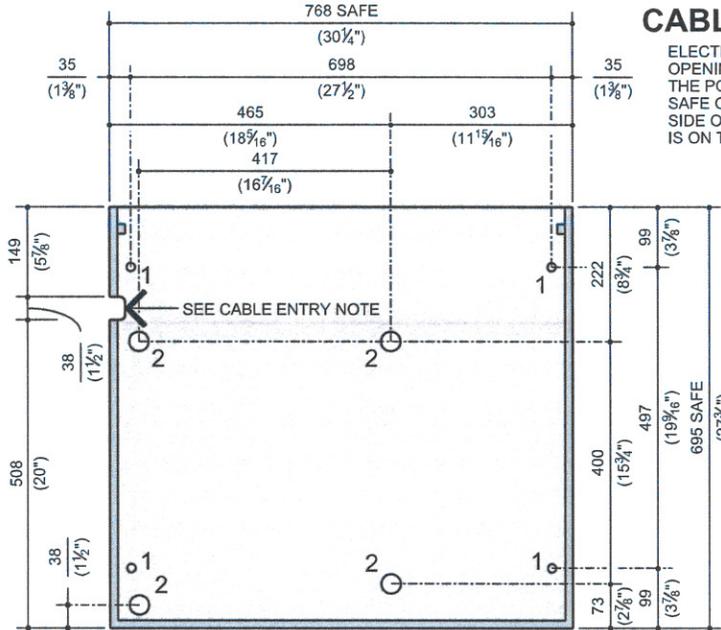

PLAN/SECTION SAFE FLOOR

- 1 (4) 14mm (9/16") DIA. LEVELING LEG HOLES
- 2 (4) 25.4mm (1") DIA. FLOOR MOUNTING HOLES

THIRD ANGLE
PROJECTION


- RECOMMENDED SERVICE AREA
- MINIMUM SERVICE AREA
- ALL ELECTRICAL AND DATA CABLES MUST ENTER UNIT IN THIS AREA

NOTE:


SHOWN IS THE MINIMUM/RECOMMENDED AREA REQUIRED FOR INSTALLATION AND SERVICE. DIMENSIONS SHOWN MAY BE INCREASED WHEREVER POSSIBLE TO IMPROVE INSTALLATION AND SERVICE ACCESS. USE OF ANY AREA LESS THAN THE RECOMMENDED AREA MAY RESULT IN AN INCREASE IN INSTALLATION AND SERVICE TIME. CONSULT WITH DIEBOLD INSTALLATION/SERVICE BRANCH FOR SPECIAL BUILDING CONDITIONS.

PAGE 4 OF 4

*ALL DIMENSIONS AND DESIGN CRITERIA
SUBJECT TO CHANGE WITHOUT NOTICE*

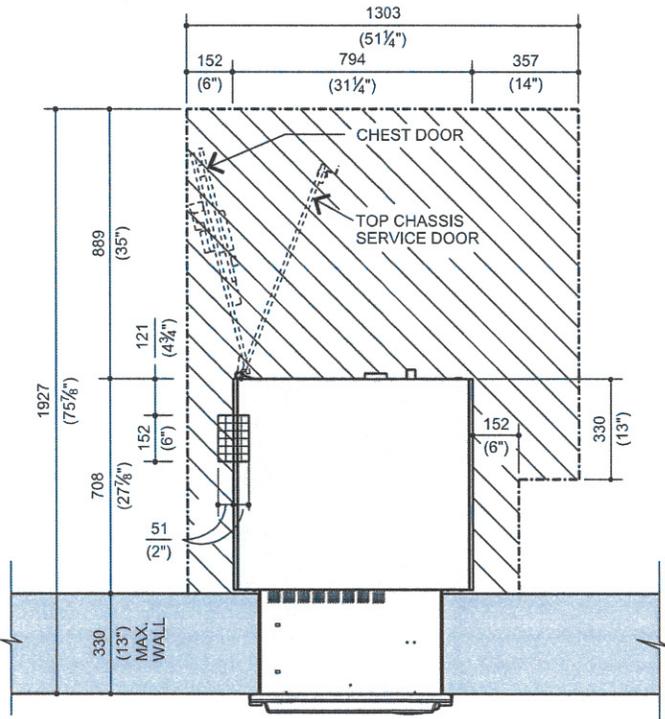

PLAN VIEW
MINIMUM SERVICE AREA

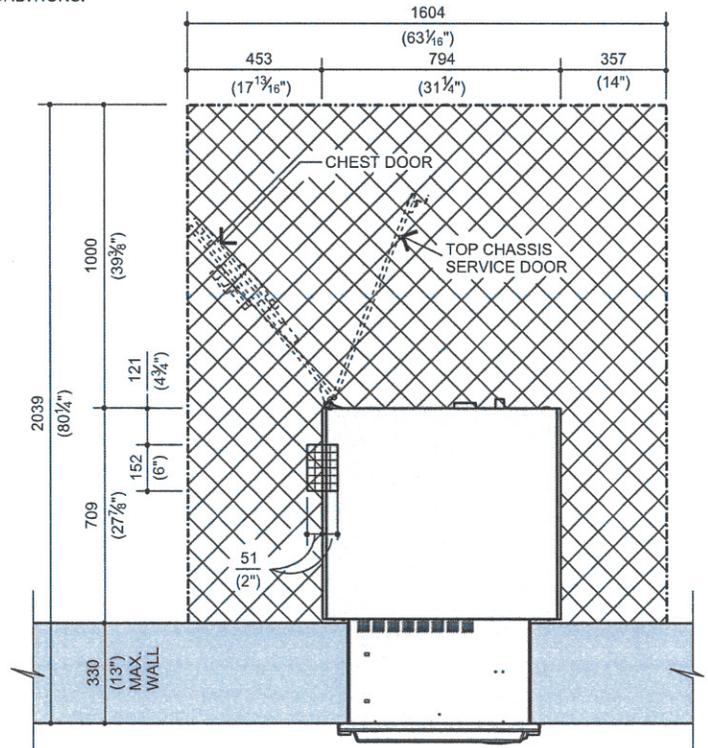

PLAN VIEW
RECOMMENDED SERVICE AREA

2594 E. Main



Maps and databases were supplied by the Franklin Co. Auditor's Office. MetaMAP, Inc. is in no way responsible or liable for the maps or databases. Any inquiries should be directed to the Franklin Co. Auditor's Office (614) 462-7272.

MapVUE



JUL 11, 2013 14:55

Proximity Report Results

7709960/3596801

The selection distance was **100 feet**.

The selected parcel was **020-003509**.

To view a table showing the **14 parcels** within the displayed proximity, scroll down.

 [Get Report](#)

 [Print Window](#)

 [Back to Proximity Report](#)

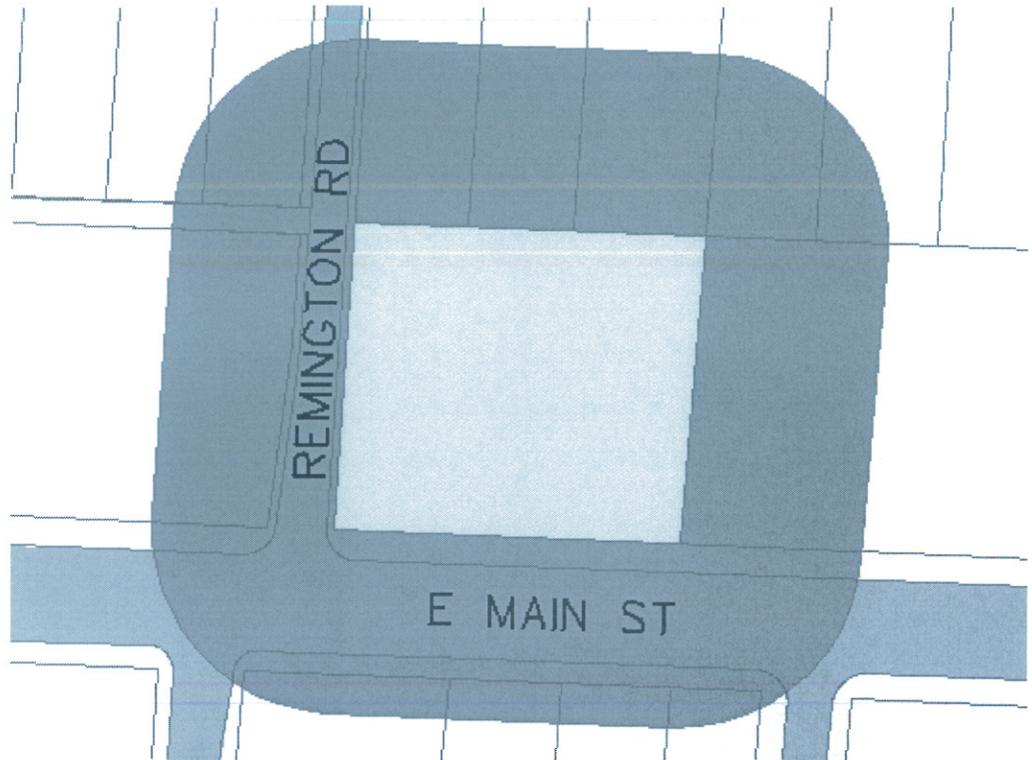


Image Date: Thu Jul 11 14:48:02 2013

Proximity Parcels

Hint: To copy this report to another program:

1. Hold down the left mouse button over the top-left corner of the area you want to get.
2. Drag the mouse to the bottom-left corner of the desired area.
3. Let go of the mouse button.
4. Select Edit Copy from the menu bar.

You can then Paste the report into another application.

Parcel	Owner Name	Address
020-000978	DUDAI MEIR DUDAI VERED	
020-000161	EISENBERG ADAM E TR EISENBERG JILL	
020-000172	KELLER STEVEN R KELLER JOYCE G	
020-001309	KROOS SHEILA B	
020-000320	LTC OHIO INC	
020-003509	OHIO NATIONAL BANK OF COLUMBUS	
020-004465	OWEN RYAN W OWEN DENESEE M	
020-003082	RITCHEY MICHAEL RITCHEY FRED	
020-002252	RODO LLC	
020-002443	RODO LLC	
020-001580	STATE SAVINGS BANK	
020-001480	TOCCO PHILIP	
020-002444	UHLIN ROBERT J & DAWN E	
020-002163	WARNER JOAN	

